




# Semiconductor Fuse

## 500-2000A, 690 Volts

BIF Document  
**17056320**  
Size **3**

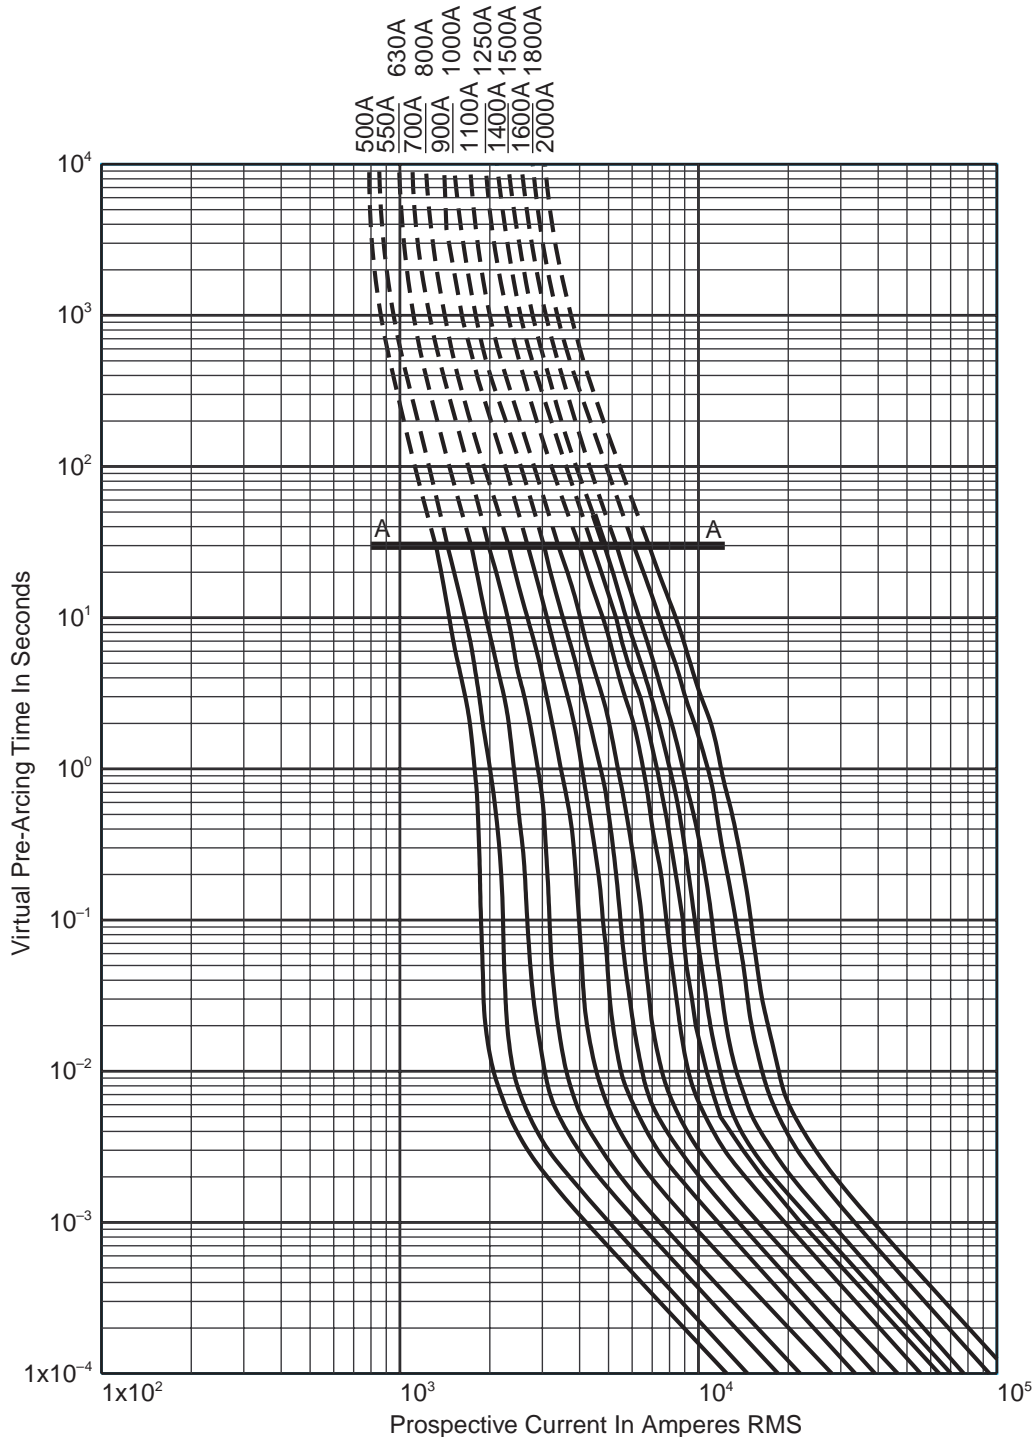

The partial dotted curves are for fuses designed to give part range protection (aR protection). Loading or operation above the curve indicated at A on the curves must in general be avoided. Please see technical guidance 170K... for further information. Curves that are not dotted are for fuses designed to give full range protection.

**Pre-Arcing** Time-Current Characteristic Curves  
**TYPOWER ZILOX**

Approved: **PK**  
Rev. Date: **OCT-94**


Page **1 of 2**  
Pub. Date: **NOV-94**



# Semiconductor Fuse

## 500-2000A, 690 Volts

BIF Document  
**17056320**  
Size **3**

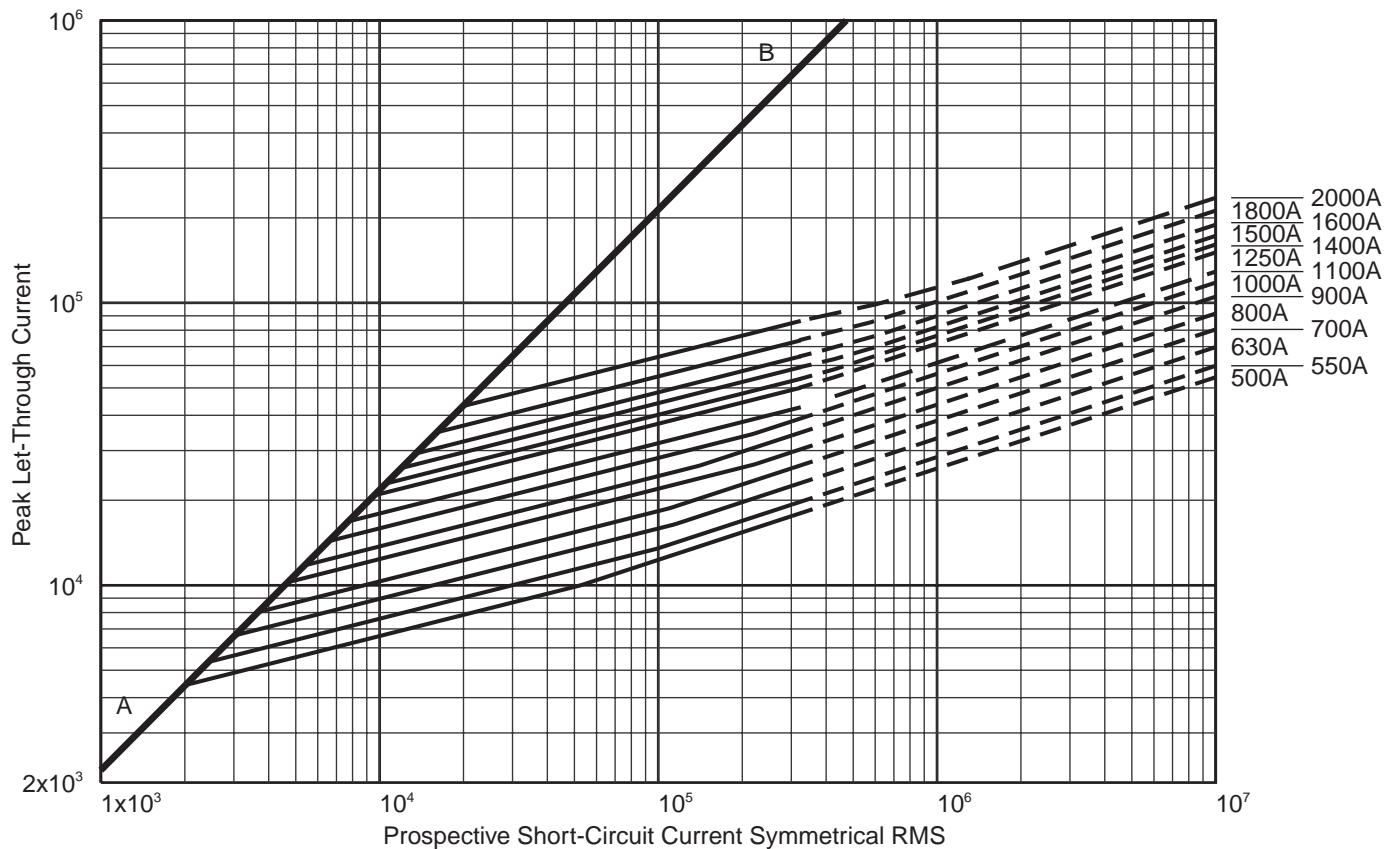

### Peak Let-Through

Cut-Off Current Characteristic Curves

**TYPOWER ZILOX**

Approved: **PK**

Page **2 of 2**

Rev. Date: **OCT-94**

Pub. Date: **NOV-94**