



SELECTION/DIMENSIONS

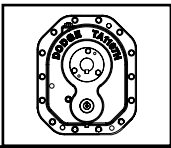


TORQUE-ARM II Shaft Mount Speed Reducers


MOTOR MOUNT DIMENSIONS - TA10507H, POSTION B & D

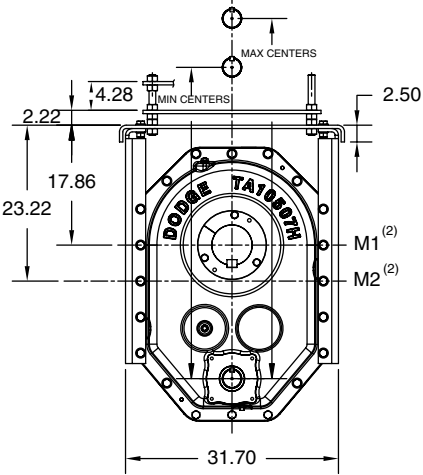


POSITION B

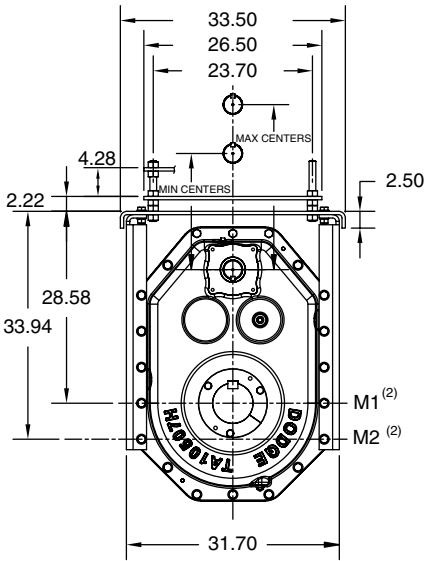

POSITION D

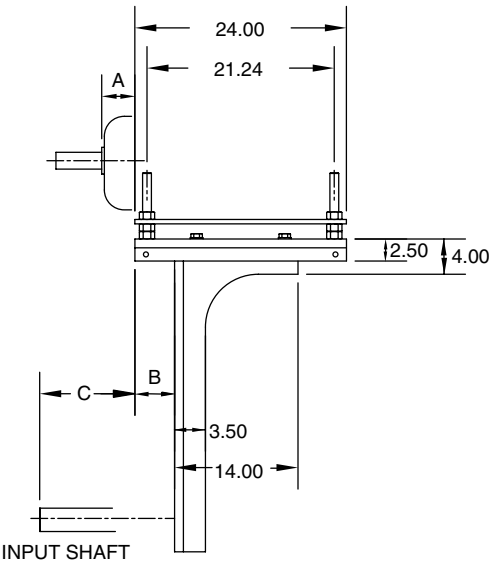

EASY SELECTION PAGE 9	SELECTION PAGE 12	RELATED PRODUCTS PAGE 123	ENGINEERING/TECHNICAL PAGE 129
--------------------------	----------------------	------------------------------	-----------------------------------



SELECTION/DIMENSIONS

TORQUE-ARM II Shaft Mount Speed Reducers

MOTOR MOUNT DIMENSIONS - TA10507H, POSTION B & D ⁽¹⁾

Mounting	Lateral Adjustment				Motor Mount Height (2)	Motor Frame								
						254T & 256T			284T & 286T			324T & 326T		
						A	Centers		A	Centers		A	Centers	
	B Min	B max	C Min	C max			Min	Max		Min	Max		Min	Max
Position B	2.18	6.82	6.98	11.62	M1	1.56	46.7	50.5	1.16	47.5	51.2	0.38	48.5	52.2
					M2		52.1	55.9		52.8	56.6		53.8	57.6
Position D	2.18	6.82	6.98	11.62	M1	1.56	17.7	21.4	1.16	18.4	22.2	0.38	19.4	23.2
					M2		23.0	26.8		23.8	27.5		24.8	28.5

Mounting	Lateral Adjustment				Motor Mount Height (2)	Motor Frame								
						364T & 365T			404T & 405T			444T & 445T		
						A	Centers		A	Centers		A	Centers	
	B Min	B max	C Min	C max			Min	Max		Min	Max		Min	Max
Position B	2.18	6.82	6.98	11.62	M1	1.01	49.5	53.2	0.75	50.5	54.2	1.62	51.5	55.2
					M2		54.8	58.6		55.8	59.6		56.8	60.6
Position D	2.18	6.82	6.98	11.62	M1	1.01	20.4	24.2	0.75	21.4	25.2	1.62	22.4	26.2
					M2		25.8	29.5		26.8	30.5		27.8	31.5

Note:

Minimum centers contains 0.5" to allow for belt assembly

(1) Motor mount will fit NEMA and IEC frame motors; hardware are inch dimensions

(2) M1, M2, M3 go through output shaft centerline